		Tesla, Inc. Service Bulletin		<i>Replace Cant Rail Assemblies</i>
SB-25-10-001 March 26, 2025				
Classification		Section/Group	Mobile Service	
Recall Bulletin		10 - Body	Cannot Perform	All
Model	Model Year	Country/Region	Build Location	
Cybertruck	2024–2025	United States, Puerto Rico, Canada	Giga Texas	
The model(s) and model year(s) listed are a general approximation of the affected VIN list. Refer to the VIN/Bulletin Tracker or Customer/Vehicle profile to determine applicability of this bulletin for a particular vehicle.				


Recall Bulletin: Recall Bulletins are mandatory service procedures that, unless they can be completed via a software update that a customer installs through the normal course of ownership, must be carried out by Tesla-certified Service Centers. Recall work performed by uncertified technicians could lead to unsafe conditions or voided warranty provisions.

Condition

On certain Cybertruck vehicles, the cant rail trim stainless steel panels may delaminate at the adhesive joint, which may cause the panel(s) to separate from the vehicle.

Correction

Replace the left hand (LH) and right hand (RH) cant rail assemblies with the remedy components.

 **NOTE:** If this bulletin is applicable to the vehicle, perform the correction without any need for inspection.


Correction Description	Correction	Time
Replace LH and RH Cant Rail Assemblies; No Butyl Patches Required	S012510001	0.66
Replace LH And RH Cant Rail Assemblies; 2 Butyl Patches Applied	S022510001	0.66
Replace LH And RH Cant Rail Assemblies; 8 Butyl Patches Applied	S032510001	0.72

	Part Number	Description	Quantity
Parts Required	1860489-97-C	CIW, CANTRAIL LH	1
	1860490-97-C	CIW, CANTRAIL RH	1
	2081194-99-A	NUT, HF, M5, [10], ZNNI, PTP	4
If Necessary	1032246-00-B	BUTYL PATCH (40x40x1mm)	2 or 8

These part numbers were current at the time of publication. Use the revisions listed or later, unless otherwise specified in the [Parts Catalog](#).

Procedure

Replace the LH and RH cant rail assemblies (refer to Service Manual procedure [1010025062](#)).

 **CAUTION:** When performing this procedure, make sure to follow the steps to install the butyl patches, if needed.

- Use Correction Code S012510001 if no butyl patches were applied during the procedure.
- Use Correction Code S022510001 if 2 butyl patches were applied during the procedure.
- Use Correction Code S032510001 if 8 butyl patches were applied during the procedure.