		Tesla, Inc. Service Bulletin		<h1>Inspect and Rework Instrument Panel</h1>	
SB-25-14-002 January 9, 2026		R1			
Classification		Section/Group		Mobile Service	Configuration
Campaign Bulletin		14 - Instrument Panel		Can Perform (where permitted)	All
Model	Model Year	Country/Region		Build Location	
Model 3	2024–2026	Europe, Middle East		Giga Shanghai	
Model Y	2025–2026			Giga Berlin	
The model(s) and model year(s) listed are a general approximation of the affected VIN list. Refer to the VIN/Bulletin Tracker or Customer/Vehicle profile to determine applicability of this bulletin for a particular vehicle.					

Campaign Bulletin: This campaign bulletin addresses a non-safety-related condition and provides recommended technical diagnosis and repair procedures. Apply this procedure to the applicable vehicles.

This Service Document supersedes SB-25-14-002, dated September 13, 2025. This new revision, R1, adds 2025+ Model Y vehicles. Each content change is marked by a vertical line in the left margin. Discard the previous version and replace it with this one.

Condition

On some Model 3 and Model Y vehicles, a rattling noise can be heard coming from the airwave or top of the instrument panel while driving on rough surfaces.

Correction

Upon customer complaint, inspect the vehicle for symptoms related to the condition. If symptoms are present, rework components in the instrument panel.

Correction Description	Correction	Time
Inspect Instrument Panel, No Symptom Found	S012514002	0.12
Inspect And Rework Instrument Panel	S022514002	0.42

	Part Number	Description	Quantity
If Necessary	1090280-00-A	U-CLIP,11.7x6.8,STL,ZN	1-17
Shop Supplies	1832735-00-A	SEALING TAPE FOR MODEL Y 10mm X 10 mm	
This part number was current at the time of publication. Use the revision listed or later, unless otherwise specified in the Parts Catalog .			

Inspection

Test drive the vehicle over rough or uneven surfaces and listen for rattling noises coming from the instrument panel float wing.

TIP: [Click here for a short video showing an example of the rattling noise.](#)

- If no rattling noise can be heard, discontinue this procedure. Close out this bulletin using correction code S012514002.
- If a rattling noise can be heard, go to the next section [Rework Instrument Panel](#).

Rework Instrument Panel

1. Remove the Instrument Panel Float Wing (refer to Service Manual procedure 1405020522, [Model 3](#); [Model Y](#)).
2. Cut 4 cm long pieces of foam tape (x4), and apply the foam tape to the illustrated areas between the instrument panel and the LH air vent assembly (Figure 1).

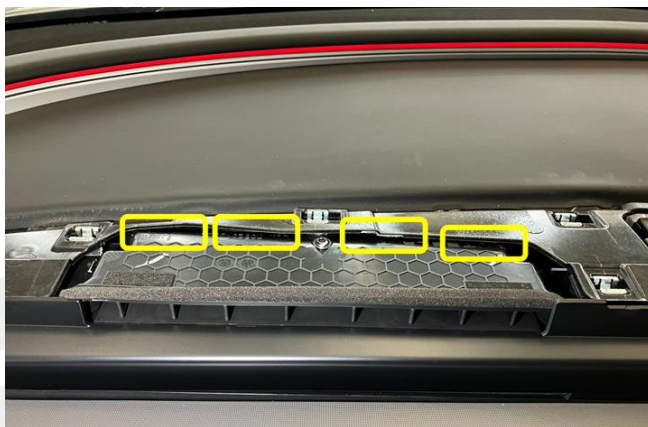


Figure 1

3. Cut 4 cm long pieces of foam tape (x2), and apply the foam tape to the LH and RH air vent assembly actuators (Figure 2).



Figure 2

4. Cut 4 cm long pieces of foam tape (x4), and apply the foam tape to the illustrated areas between the instrument panel and the RH air vent assembly (Figure 3).



Figure 3

5. Install the Instrument Panel Float Wing (refer to Service Manual procedure 1405020522, [Model 3](#); [Model Y](#)).
6. Perform a short test drive to confirm there are no more rattling noises coming from the instrument panel.
7. Close out this bulletin using correction code S022514002.

