

		Tesla, Inc. Service Bulletin		<i>Replace 19" Crossflow Wheel Covers</i>
SB-25-34-002 November 27, 2025				
Classification		Section/Group	Mobile Service	
Repair Bulletin		34 - Wheels & Tires	Can Perform (where permitted)	19" Crossflow Wheels
Model	Model Year	Country/Region	Build Location	
Model Y	2025	Europe, Middle East, Africa, Canada, Taiwan	Giga Berlin	
The model(s) and model year(s) listed are a general approximation of the affected VIN list. Refer to the VIN/Bulletin Tracker or Customer/Vehicle profile to determine applicability of this bulletin for a particular vehicle.				

This repair bulletin provides instructions on addressing a possible customer concern regarding the operation of Tesla vehicles. These instructions should only be performed by trained professionals.

Condition

On some Model Y vehicles built at Giga Berlin, the 19" Crossflow wheel covers may produce a clicking, creaking or squeaking noise perceived from outside the vehicle during vehicle movements at low speed.

Correction

Upon customer complaint, inspect the vehicle for symptoms related to the condition. If symptoms are present, replace all wheel covers with the updated parts.

Correction Description	Correction	Time
Inspect for Noise from Wheel Covers; No Noise Perceived	S012534002	0.06
Inspect for Noise from Wheel Covers; Noise Perceived and Wheel Covers Replaced	S022534002	0.06

Part Number	Description	Quantity
Parts Required 2188236-10-C	19" CROSSFLOW WHEEL COVER KIT	1
This part number was current at the time of publication. Use the revision listed or later, unless otherwise specified in the Parts Catalog.		

Procedure

- Open all windows and drive the vehicle at a speed of 3 to 5 km/h. Determine if a clicking, creaking or squeaking noise is perceived from outside the vehicle.
 - If no noise is perceived from outside the vehicle, close out this bulletin using correction code S012534002. Perform further diagnosis to remedy the customer's complaint.
 - If noise is perceived from outside the vehicle, replace the wheel covers (x4) (refer to Service Manual procedure [34015022](#)). Close out this bulletin using correction code S022534002.