

		Tesla, Inc. Service Bulletin		<h1>Replace Front Dampers</h1>	
SB-26-31-003 May 8, 2026					
Classification		Section/Group		Mobile Service	Configuration
Campaign Bulletin		31 - Suspension		Cannot Perform	Performance, Premium
Model	Model Year	Country/Region		Build Location	
Model Y	2025+	North America		Fremont, Giga Texas	
The model(s) and model year(s) listed are a general approximation of the affected VIN list. Refer to the VIN/Bulletin Tracker or Customer/Vehicle profile to determine applicability of this bulletin for a particular vehicle.					

Campaign Bulletin: This campaign bulletin addresses a non-safety-related condition and provides recommended technical diagnosis and repair procedures. Apply this procedure to the applicable vehicles.

Condition

Certain Model Y vehicles may emit rattling or knocking noises when driving over bumps or rough road. The condition can be improved by replacing the front upper control arm mounts, replacing the front damper assemblies, and removing the wiper bracket pencil braces. This document is for vehicles that have already had the front upper control mounts replaced and the wiper bracket pencil braces removed.

Correction

Replace the front damper assemblies with updated parts.

Correction Description	Correction	Time
Replace Front Dampers - Pair	S012631003	0.88

Part Number	Description	Quantity
Parts Required		
All Vehicles		
1111543-00-A	NUT, HF, M12-1.75, [10], ZNNI, PTP	2
RWD, Fremont-built Vehicles:		
2188363-00-D	DAMPER ASSY FR LH, COIL RWD-CA	1
2188363-01-D	DAMPER ASSY FR RH, COIL RWD-CA	1
RWD, Giga Texas-built Vehicles:		
2188360-00-D	DAMPER ASSY FR LH, COIL RWD-TX	1
2188360-01-D	DAMPER ASSY FR RH, COIL RWD-TX	1
AWD, Fremont-built Vehicles:		
2188367-00-D	DAMPER ASSY FR LH, COIL DM-CA	1
2188367-01-D	DAMPER ASSY FR RH, COIL DM-CA	1
AWD, Giga Texas-built Vehicles:		
2188368-10-D	DAMPER ASSY FR LH, COIL DM-TX	1
2188368-01-D	DAMPER ASSY FR RH, COIL DM-TX	1
These part numbers were current at the time of publication. Use the revisions listed or later, unless otherwise specified in the Parts Catalog .		

Shop Supplies N/A

Procedure

Replace the LH and RH front damper coil assemblies. Refer to Service Manual procedure [3115010502](#) (RWD) or [3115010102](#) (AWD).