 <b>Tesla, Inc.</b> <b>Service Bulletin</b>		<h1>Replace Front Brake Rotors</h1>	
<b>SB-26-33-002</b> March 26, 2026		<b>R1</b>	
<b>Classification</b>		<b>Section/Group</b>	<b>Mobile Service</b>
Repair Bulletin		33 - Brakes	Can Perform (where permitted)
<b>Model</b>	<b>Model Year</b>	<b>Country/Region</b>	<b>Build Location</b>
Model Y	2025–2026	Europe, Middle East, Africa, Taiwan, Canada, Australia, New Zealand	Giga Berlin
<small>The model(s) and model year(s) listed are a general approximation of the affected VIN list. Refer to the VIN/Bulletin Tracker or Customer/Vehicle profile to determine applicability of this bulletin for a particular vehicle.</small>			

This repair bulletin provides instructions on addressing a possible customer concern regarding the operation of Tesla vehicles. These instructions should only be performed by trained professionals.


*This Service Document supersedes SB-26-33-002, dated February 25, 2026. This new revision, R1, adds a note for Mobile technicians to use a floor jack to raise the vehicle. Each content change is marked by a vertical line in the left margin. Discard the previous version and replace it with this one.*

## Condition

On certain model year 2025 and 2026 Model Y vehicles built at Giga Berlin, the front brakes may exhibit a squealing noise when braking in cold and/or humid conditions.

## Correction

Upon customer complaint of a squealing noise coming from the front brakes during braking on a vehicle that has driven less than 50,000 km (31,070 miles), replace the front brake rotors with the updated part.


 **NOTE:** If this bulletin is applicable to the vehicle, perform the correction without any need for inspection.

Correction Description	Correction	Time
Replaced Front Brake Rotors and Burnished the Brakes	S012633002	0.84

	Part Number	Description	Quantity
<b>Parts Required</b>	1088969-00-B	BOLT,TE,M12-1.75x45,[109],G0110[B],SMAT	4
	<b>For all countries except Canada</b>		
	2188611-00-A	FRONT BRAKE ROTOR	2
	<b>For Canada</b>		
	1188611-00-A	FRONT BRAKE ROTOR	2
	<small>These part numbers were current at the time of publication. Use the revisions listed or later, unless otherwise specified in the <a href="#">Parts Catalog</a>.</small>		
<b>Special Tools</b>	1082171-00-A	S-HOOK, BRAKE CALIPER (SET OF 2)	

## Procedure

1. Replace the front brake rotors (refer to Service Manual procedure [3301011102](#)).

 **NOTE:** Mobile technicians can use a floor jack to raise the vehicle (refer to Service Manual procedure [10001105](#)).

2. Burnish the brakes (refer to Service Manual procedure [33013000](#)).