 Tesla, Inc. Service Bulletin		<h2 style="margin: 0;">Remove Side Apron Seals And Install Clips</h2>	
SB-24-12-004 May 29, 2024			
Classification Repair Bulletin		Section/Group 12 - Exterior Fittings	Mobile Service Can Perform (where permitted)
		Configuration All	
Model Cybertruck	Model Year 2024	Country/Region North America	Build Location Giga Texas
<small>The model(s) and model year(s) listed are a general approximation of the affected VIN list. Refer to the VIN/Bulletin Tracker or Customer/Vehicle profile to determine applicability of this bulletin for a particular vehicle.</small>			

Repair Bulletin: This repair bulletin provides instructions on addressing a possible customer concern regarding the operation of Tesla vehicles. These instructions should only be performed by trained professionals.

Condition

On certain Cybertruck vehicles, the LH and/or RH side apron seal may be visible through the frunk-to-fender gap (Figure 1).

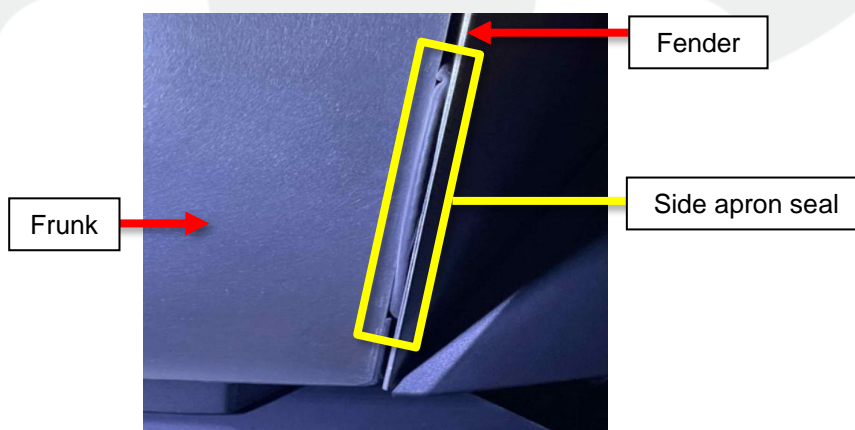


Figure 1

Correction

Upon customer complaint, remove and discard the LH and RH side apron seals, and then plug the holes in the LH and RH side apron assemblies with clips.

Correction Description	Correction	Time
SB-24-12-004 Not Applicable	S012412004	0.00
Remove And Discard LH And RH Side Apron Seals; Install Clips Into Side Aprons	S022412004	0.06

Part Number	Description	Quantity
Parts Required 2067863-00-A	BRSH-CLIP,4.9,GR2.8-3.3,P66,[B]	6

This part number was current at the time of publication. Use the revisions listed or later, unless otherwise specified in the [Parts Catalog](#).

Procedure

1. Open the frunk.

2. Use a prytool to release the clips (x3) that attach the LH side apron seal to the side apron assembly (Figure 2). Remove and discard the seal, and then repeat this step on the RH side apron seal.

⚠ CAUTION: Use care when releasing the clips so as to prevent damage to surrounding components.

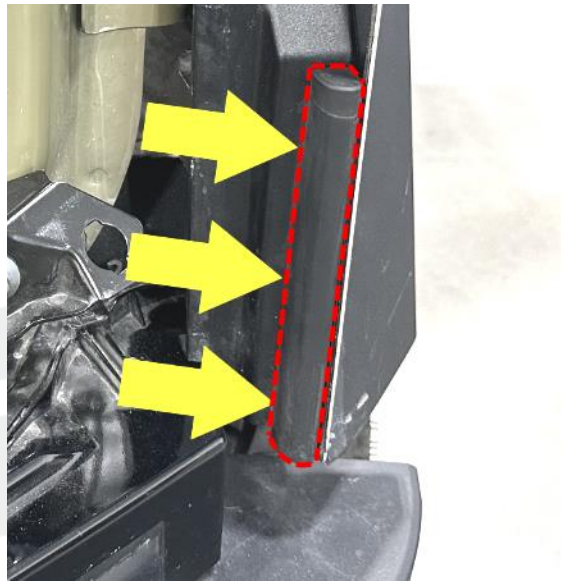


Figure 2 - LH shown; RH similar

3. Install the clips (x6 total) into the LH and RH side apron assembly holes that were previously populated by the side apron seals (Figure 3).



Figure 3 - LH shown; RH similar

4. Close the frunk.